



Before starting

- 1. Prevent pipes from breaking or turning oval:
 - Transport pipes correctly: well lined, not in bulk; move them carefully and place them gently. •
 - Store pipes correctly: stack them up to a maximum height of 1,50 meters; protect them from direct sunlight. •
- 2. Be ware of local circumstances:
 - Work at temperatures between +5 and +25°C, if possible. DO NOT use in temperatures below +5°C.
 - Make sure to work in a clean and dry work place.
 - Work only in a well ventilated area.
 - Prevent risk of condensation.
- 3. Make sure you have everything you need:
 - Pipes / Fittings
 - Solvent cement / Cleaner
 - Tools
 - Personal protective equipment
- 4. Check equipment before getting started:
 - Do I have the right solvent cement? (EFFAST TITE for diameters up to 160 mm; EFFAST LARGE TITE for diameters over 160 mm)
 - Do I have the right amount? (See table "Consumption of solvent cement and cleaner")
 - Is the guality still OK? (Check expiring date; the cement inside the packaging should not be dry)
 - Do pipes fit well into the fittings? (Pipe should enter the fitting and reach the bottom of the socket depth)
- A Read the safety instructions on the label of the product and consult the safety data sheet (MSDS). 5.

TOOLS:

Ø

#

- PVC saw (and mitre-box) or special pipe cutter •
- Chamfer tool, deburring tool or file .
- Permanent marker
- Sandpaper .
- Cleaner cloth
- Brush (brush size varies per packaging volume: use a suitable packaging and the enclosed brush for the diameter to be bonded - see information on datasheets)

Consumption of solvent cement and cleaner

290

160

100

Number of joints per 1 liter of cement:

650

PERSONAL PROTECTIVE EQUIPMENT:

- Gloves •
- Eye protection .
- Appropriate respiratory equipment •

	EFFAST TITE & EFFAST LARGE TITE									
32	40	50	63	75	90	110	125	160	20	

70

40

30

20

90

					EFFAST (CLEANER	ł				
Ø	32	40	50	63	75	90	110	125	160	200	250
#	800	700	650	550	330	250	160	140	90	50	35

12

250

8

Preparation and Solvent cementing process

For large diameters, see Additional recommendations.

- 1. Cut pipes square, using PVC saw (with mitre box if possible) or special pipe cutter (a diagonal cut reduces bonding area in the most effective and critical part of the joint).
- 2. Chamfer the edges of the pipes at an angle of 15°, using a special chamfer tool, a deburring tool or a file *(it makes mounting more easy, it prevents scraping away of cement)*. Deburr pipe edges if necessary, using a deburring tool or a file.
- 3. Measure put-in depth and mark this measure on the pipe: this will indicate were to apply cement. Mark the right assembly positions.







- 4. Clean surfaces with EFFAST CLEANER and cleaner cloth (cleaner prepares surfaces of pipes and fittings, and it cleans dirt, grease, or any foreign material that can prevent proper cementing). If EFFAST CLEANER is not used, it is absolutely recommended to sand the surfaces to be joined - outside of the pipe and inside of the fitting - using sandpaper, to ensure a good grip of the adhesive. Sanding can still be used, before applying the cleaner, to increase the grip of the adhesive.
- 5. Let parts dry well (prevent risk for condensation).







- 6. Stir or shake the cement before using.
- 7. Apply cement rapidly and evenly all around (4-6x) on both surfaces (pipe thickly, socket thinly).
- 8. Assemble joint immediately, while cement is still wet. DO NOT assemble partially cured surfaces.
- 9. Hold the pipe and fitting together for a minimum of 30 seconds.







- 10. Remove excess cement with cleaner cloth and cleaner, avoiding moving the joint.
- 11. Close packaging immediately after use.
- 12. Respect drying times:
 - DO NOT load the joint mechanically for the first 10 minutes.
 - Wait until the curing time has elapsed before handling or testing the piping system (see "Curing time" tables).
- 13. Visually check the joint: after assembly, a joint should have a ring of cement completely around the juncture of the pipe and fitting. If gaps in this ring are present, sufficient cement was not applied and the joint may be defective.



Curing time

Curing time may vary depending on a.o. surface, product quantity used, humidity level and ambient temperature.

EFFAST TITE									
		16 - 50 mm			63 - 110 mm		125 - 160 mm		
	5 bar	10 bar	16 bar	5 bar	10 bar	16 bar	5 bar	10 bar	16 bar
5 - 15 °C	30 min	1 h	4 h	1 h	2 h	8 h	4 h	16 h	32 h
> 15 °C	15 min	30 min	2 h	30 min	1 h	4 h	2 h	8 h	16 h

EFFAST LARGE TITE

	16 - 63 mm				75 - 110 mm	125 - 400 mm		
	5 bar	10 bar	16 bar	5 bar	10 bar	16 bar	5 bar	10 bar
5 - 10 °C	6 h	12 h	24 h	12 h	24 h	48 h	36 h	72 h
> 10 °C	2 h	4 h	8 h	4 h	8 h	16 h	12 h	24 h

Additional recommendations

Large diameters (over 160 mm)

following the instructions in the beginning of this guide along with the following additional recommendations:

- Use a flat brush to apply the cement.
- We recommend to use EFFAST LARGE TITE solvent cement.
- Increase size of joining crew: diameters from 160 mm to 225 mm: 2-3 people per joint; diameters over 250 mm: 3-4 people per joint. It is important that the cement is applied to pipe and fittings at the same time.

Extreme conditions - High temperatures (> 25°C)

- If possible, store fittings and pipe, or at least the ends to be joined, in a shady area before cementing.
- Cool the surfaces to be joined by wiping with a damp rag. Make sure that the surfaces are dry before applying solvent cement.
- It is preferable to do the solvent cementing during the cooler morning hours.
- Make sure that cement on both surfaces to be joined is still wet when you join them. Operations should be executed fast, so more people on the crew may be necessary.

Condensation

Condensation could cause adhesive failure. Prevent risk for condensation:

- Work fast (the longer the parts are exposed, the higher the risk)
- Dry surfaces well after cleaning with cleaner
- Make sure that the temperature of the cement, pipe and fittings is higher than the temperature of the work space

Safety

▲	 Solvent cements and cleaners contain solvents: Read the safety instructions on the label of the product and consult the safety data sheet (MSDS). Respect these safety instructions.
▲	 Minimize the risk of getting exposed to solvents: Ventilate well, at the lowest place possible (solvents are heavier than air). Immediate close packaging after use and deposit cleaning-rags etc. in a closed container.

▲	Use appropriate personal protection equipment.
▲	 Work under normal hygienic conditions: Do not smoke, eat or drink during work. Before breaks (eat, drink) take off work clothes and wash hands with water and soap.



All descriptions and illustrations in this publication are intended for guidance only and shall not constitute a 'sale by description'. All dimensions given are nominal, while changes can be done on the information, products and specifications from time to time for a variety of reasons, without prior notice. The information in this publication is provided 'as is' on the revision date stated on the sheet. Updates will not be issued automatically. This information is not intended to have any legal effect, whether by way of advice, representation or warranty (express or implied). We accept no liability whatsoever (to the extent permitted by law) if you place any reliance on this publication you must do so at your own risk. All rights reserved. Copyright in this publication by copyright may not be used, sold, copied or reproduced in whole or part in any manner in any media to any person without prior consent.

Polypipe Italia Loc. Pianmercato 5C-5D-5H, 16044 Cicagna (GE), Italy Tel: +39 0185 92399 E-mail: info@effast.com

www.effast.com

